

Access Central™ Release Notes

From 5.4.29 — August 2023 5.4.39

Technical Support: T: +44 (0)1707 377203 | E: pacgdxsupport@comelit-pac.co.uk

Latest Release Download: <https://pacgdx.com/products/pac-access-central/>

Contents

5.4.39	1
5.4.37	1
5.4.36	1
5.4.29	2

5.4.39

Bug Fixes

- Access Central™ Mini – Browser shows error when logged in.

Enhancements

- Quick print an ID card without using the dropdown option.

5.4.37

Bug Fixes

- TWAIN is no longer an option on the Image Capture dialog.

5.4.36

New Features

- Multi-lingual help files added.

Enhancements

- Keyholder multi-edit.

Bug Fixes

- System Incorrectly Reports License Violation: "Too Many Controllers per Channel".
- Event to Action with Time Profile trigger was not using the time zone correctly.
- Archive Restoral Access Central - String or Binary data would be truncated Error.
- The API could not handle 64 bit key codes.
- Entity names with "&" characters were causing Event to Action to fail.

Firmware

- PAC51x DCi V5.1.34
- PAC512 DC V5.0.2

5.4.29

New Features

- 3T Wiegand Token format added.
- CSN Token format added – a channel download may be required depending on the active token formats being used.
 - For installs that are earlier than V5.4.20 and NOT using token format 'PAC Proximity Reader' all channels will be set to "unloaded" and will require a channel download for each channel.
 - For installs that are earlier than V5.4.20 and using ONLY token format 'PAC Proximity Reader', channels will not be set "unloaded".
 - Upgrades from V5.4.20 onwards will not set channels "unloaded."
- Low Bandwidth Mode – option to reduce network traffic that is activated via a channel tick box. This feature allows the system to POLL each controller once every 60 seconds instead of once every ½ second. Each controller is polled in turn and a maximum of four events per POLL will be returned. If there are any backlogged events identified for a controller, a series of POLLS will be issued until the channel is up to date.

Enhancements

- Active Directory – more efficient keyholder import. Imports update in batches of 100 keyholders and display a progress bar for indicate progress. This improvement also makes the update process more resilient, as any issues with the import do not rollback any updates already committed.
- Fingerprint enrolment – automatic retries. The software will automatically retry up to 15 times before prompting to retry again.

Bug Fixes

- When removing a fingerprint from an ievio keyholder, access to the door is removed completely regardless of whether there are existing prints.
- Access is permitted to a child area when entrance GAPB door is tailgated.
- Adding a 'Simple' Time Profile Time generates the Error Message 'Controller or Organisation does not support "weekly" time periods.
- Keyholder Image Capture showing a blank image.
- Door 'Open' option missing during controller download.
- Lift Setup not allowing the Channel Download
- 511 Reader 2 not reporting events.

Firmware

- PAC51x DCi V5.1.32
- PAC512 DC V5.0.27